



MATERIAL SAFETY DATA SHEET

OXI LYTE

PARISER INDUSTRIES

TRADE SECRET REGISTRY #

307554-5524P

PRODUCT NAME: OXI LYTE

TRADE SECRET REGISTRY #

HMIS CODES: H F R P

UN NUMBER : 5.1, 8, UN2014, PGII

3 0 1 B

===== SECTION I - MANUFACTURER IDENTIFICATION =====

MANUFACTURER'S NAME: PARISER INDUSTRIES
ADDRESS : 91 MICHIGAN AVE
PATERSON, NJ 07503

EMERGENCY PHONE : 800-424-9300 DATE PRINTED : 3/6/2006
INFORMATION PHONE : 973-569-9090 NAME OF PREPARER : ENVIRONMENTAL DEPT

===== SECTION II - HAZARDOUS INGREDIENTS/SARA III INFORMATION =====

REPORTABLE COMPONENTS	CAS NUMBER	VAPOR PRESSURE		WEIGHT
		mm Hg @	TEMP	PERCENT
HYDROGEN PEROXIDE 50% OSHA PEL 1.5mm/mg3	7722-84-1	18mmHG	86°F	50.00

*** No toxic chemical(s) subject to the reporting requirements of section 313 of Title III and of 40 CFR 372 are present. ***

===== SECTION III - PHYSICAL/CHEMICAL CHARACTERISTICS =====

pH 1% SOLUTION : 7.7
BOILING RANGE: 114°C SPECIFIC GRAVITY (H2O=1): 1.09
VAPOR DENSITY: N/A EVAPORATION RATE: N/A
COATING V.O.C.: NOT APPLICABLE MATERIAL V.O.C.: NOT APPLICABLE
SOLUBILITY IN WATER: SOLUBLE
APPEARANCE AND ODOR: CLEAR LIQUID WITH NO DISTINCT ODOR

===== SECTION IV - FIRE AND EXPLOSION HAZARD DATA =====

FLASH POINT : NON-FLAMMABLE METHOD USED: n/a
FLAMMABLE LIMITS IN AIR BY VOLUME- LOWER: n/a UPPER: n/a

EXTINGUISHING MEDIA:
UNIVERSAL FOAM, DRY CHEMICAL, WATER SPRAY/FOG, CLASS BC OR ABC FIRE EXTINGUISHERS.

SPECIAL FIREFIGHTING PROCEDURES
USE WATER SPRAY TO COOL FIRE-EXPOSED CONTAINERS AND STRUCTURES. USE WATER SPRAY TO DISPERSE VAPORS; RE-IGNITION IS POSSIBLE. USE SELF-CONTAINED BREATHING APPARATUS AND PROTECTIVE CLOTHING.

UNUSUAL FIRE AND EXPLOSION HAZARDS
FIREFIGHTERS SHOULD WEAR SELF-CONTAINED POSITIVE-PRESSURE BREATHING APPARATUS AND AVOID SKIN CONTACT

===== SECTION V - REACTIVITY DATA =====



MATERIAL SAFETY DATA SHEET

OXI LYTE

PARISER INDUSTRIES

TRADE SECRET REGISTRY #

307554-5524P

STABILITY: STABLE
CONDITIONS TO AVOID
HEAT, SPARKS AND FLAMES

INCOMPATIBILITY (MATERIALS TO AVOID)
CONTACT WITH STRONG OXIDIZING AND/OR REDUCING AGENTS MAY RESULT IN RAPID ENERGY RELEASE. AVOID STRONG BASES AT HIGH TEMPERATURES, STRONG ACIDS AND MATERIALS REACTIVE WITH HYDROXYL COMPOUNDS

HAZARDOUS DECOMPOSITION OR BYPRODUCTS
MAY REACT DANGEROUSLY WITH RUST, DUST, DIRT, IRON, COPPER, HEAVY METALS OR THEIR SALTS (SUCH AS MERCURIC OXIDE OR CHLORIDE), ALKALIS, AND WITH ORGANIC MATERIALS (ESPECIALLY VINYL MONOMERS)

HAZARDOUS POLYMERIZATION: WILL NOT OCCUR

===== SECTION VI - HEALTH HAZARD DATA =====

INHALATION HEALTH RISKS AND SYMPTOMS OF EXPOSURE
REMOVE TO FRESH AIR. IF NOT BREATHING, GIVE ARTIFICIAL RESPIRATION, PREFERABLY MOUTH-TO-MOUTH. IF BREATHING IS DIFFICULT, GIVE OXYGEN. CALL A PHYSICIAN.

SKIN AND EYE CONTACT HEALTH RISKS AND SYMPTOMS OF EXPOSURE
FLUSH WITH WATER SEEK MEDICAL ATTENTION

SKIN ABSORPTION HEALTH RISKS AND SYMPTOMS OF EXPOSURE
SEE ABOVE

INGESTION HEALTH RISKS AND SYMPTOMS OF EXPOSURE
DRINK LARGE QUANTITIES OF WATER TO DILUTE THE MATERIAL. DO NOT INDUCE VOMITING

HEALTH HAZARDS (ACUTE AND CHRONIC)
SEE ABOVE

CARCINOGENICITY: NTP CARCINOGEN: No IARC MONOGRAPHS: No OSHA REGULATED: Yes

MEDICAL CONDITIONS GENERALLY AGGRAVATED BY EXPOSURE
MAY AGGRAVATE EXISTING SKIN AND/OR EYE CONDITIONS ON CONTACT.

EMERGENCY AND FIRST AID PROCEDURES
INGESTION: IF PATIENT IS CONSCIOUS, GIVE TWO GLASSES OF WATER. DO NOT INDUCE VOMITING. IF SIGNS AND SYMPTOMS OF TOXICITY APPEAR, CALL A PHYSICIAN. SKIN: WASH WITH SOAP AND WATER. INHALATION: REMOVE TO FRESH AIR. IF BREATHING IS DIFFICULT, ADMINISTER OXYGEN; IF BREATHING HAS STOPPED, ADMINISTER ARTIFICIAL RESPIRATION. OBTAIN MEDICAL ATTENTION. EYES: FLUSH THOROUGHLY WITH WATER.

===== SECTION VII - PRECAUTIONS FOR SAFE HANDLING AND USE =====

STEPS TO BE TAKEN IN CASE MATERIAL IS RELEASED OR SPILLED
CLEANUP PERSONNEL MUST WEAR PROPER PROTECTIVE EQUIPMENT. IF MATERIAL IS SPILLED, STEPS SHOULD BE TAKEN TO CONTAIN



MATERIAL SAFETY DATA SHEET

OXI LYTE

PARISER INDUSTRIES

TRADE SECRET REGISTRY #

307554-5524P

LIQUIDS AND PREVENT DISCHARGES TO STREAMS OR SEWER SYSTEMS. SPILLS OR RELEASES SHOULD BE REPORTED, IF REQUIRED, TO THE APPROPRIATE LOCAL, STATE AND FEDERAL REGULATORY AGENCIES.

WASTE DISPOSAL METHOD

IF MATERIAL CAN NOT BE SALVAGED, A METHOD IS NEUTRALATION FOLLOWED BY DISCHARGE INTO A TREATMENT SYSTEM IN ACCORDANCE WITH ALL LOCAL, STATE, AND FEDERAL REGULATIONS.

PRECAUTIONS TO BE TAKEN IN HANDLING AND STORING

CAUSES EYE IRRITATION. KEEP AWAY FROM HEAT, SPARKS, AND FLAME. AVOID CONTACT WITH EYES. KEEP CONTAINER CLOSED. USE WITH ADEQUATE VENTILATION. WASH THOROUGHLY AFTER HANDLING.

OTHER PRECAUTIONS

N/A

===== SECTION VIII - CONTROL MEASURES =====

RESPIRATORY PROTECTION

USE SELF-CONTAINED BREATHING APPARATUS IN HIGH VAPOR CONCENTRATIONS.

VENTILATION

GENERAL MECHANICAL VENTILATION OR LOCAL EXHAUST SHOULD BE SUITABLE TO KEEP VAPOR CONCENTRATIONS BELOW TLV. VENTILATION EQUIPMENT SHOULD BE EXPLOSION PROOF.

PROTECTIVE GLOVES

RUBBER OR VINYL GLOVES SHOULD BE WORN WHEN HANDLING THIS MATERIAL.

EYE PROTECTION

WEAR CHEMICAL SAFETY GOGGLES PLUS FULL FACE SHIELD TO PROTECT AGAINST SPLASHING.

OTHER PROTECTIVE CLOTHING OR EQUIPMENT

IMPERVIOUS PROTECTIVE CLOTHING AND CHEMICALLY RESISTANT SAFETY SHOES SHOULD BE WORN TO MINIMIZE CONTACT. WASH CONTAMINATED CLOTHING WITH SOAP AND WATER AND DRY BEFORE REUSE. SHOWERS AND EYEWASH FACILITIES SHOULD BE ACCESSIBLE.


WORK/HYGIENIC PRACTICES

WARM WATER SHOWERING AND HANDWASHING IS SUGGESTED AFTER WORKING IN EXTREMELY DUSTY AREAS. EYEWASH STATIONS ARE RECOMMENDED IN THE WORK AREA. THOROUGHLY WASH WITH SOAP AND WATER BEFORE HANDLING FOOD, SMOKING OR APPLYING MAKEUP. WASH CONTAMINATED CLOTHING AND DRY BEFORE REUSE.

===== SECTION IX - DISCLAIMER =====

TO THE BEST OF OUR KNOWLEDGE, THE INFORMATION CONTAINED HEREIN IS ACCURATE, OBTAINED FROM SOURCES BELIEVED BY PARISER INDUSTRIES, INC., TO BE ACCURATE. AS WITH ALL CHEMICALS, KEEP AWAY FROM CHILDREN, ANIMALS, AND FOOD PRODUCTS. FOR INDUSTRIAL USE ONLY, USE AS DIRECTED.

===== SECTION X - UN CODE =====

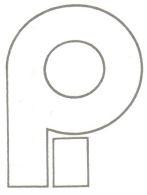

MATERIAL SAFETY DATA SHEET

Page: 4
3/6/2006

OXI LYTE

PARISER INDUSTRIES

TRADE SECRET REGISTRY #

307554-5524P

5.1, 8, UN2014, PGII